

SERVICE BULLETIN

AMATEUR RADIO

SUBJECT

TR-9130 Low Drive Level

DATE

7-05-83


For reported cases of low transmit power output check the level of the TX driver transistor Q7 of the DRIVE unit (X47-1090-00). If the TX drive level is low make the following changes.

Old Part

Q7: 3SK97 (Q1)
R36: 100Ω

New Part

3SK122(L)
68Ω (RD14BB2E680J)

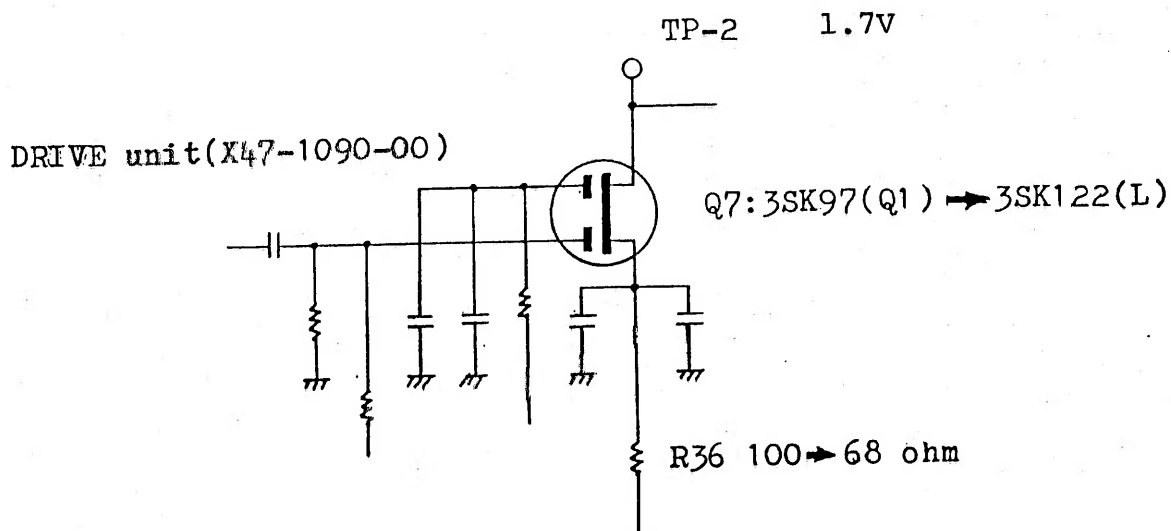

Time required for this change is ½ hour.

CLM